



## P238 Product Alert


### P238 Product Alert – Reassembly

During reassembly of the pistol, the operator is required to depress the ejector when installing the slide onto the frame.

This step is shown as item 4 on page 42 of the P238 Operators Manual:

**“4. Guide the slide assembly onto the frame rails from the front until the barrel lug is aligned with slide stop pin hole in frame and partially insert slide stop pin.**

**- note: depress the ejector “A” to clear slide.\*”**

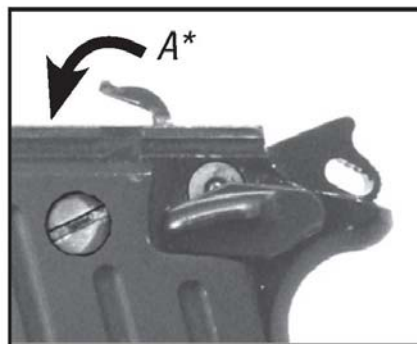

The ejector should be depressed only far enough to provide clearance for the slide during assembly. Depressing the ejector beyond the point required for reassembly may cause the ejector to bind in the frame. Should this occur, the ejector will not return to the normal position. This condition is not correctable at the operator level - the pistol will have to be returned to SIG SAUER for repair.

**CAUTION: OVER EXTENTION OF THE EJECTOR DURING ASSEMBLY MAY CAUSE THE EJECTOR TO BIND, PREVENTING SHELL CASINGS TO EJECT DURING FIRING.**

Should you have questions relating to this Product Alert or need to return your pistol for repair, please contact Customer Service at (603) 772-2302.